



Manual Container terrace

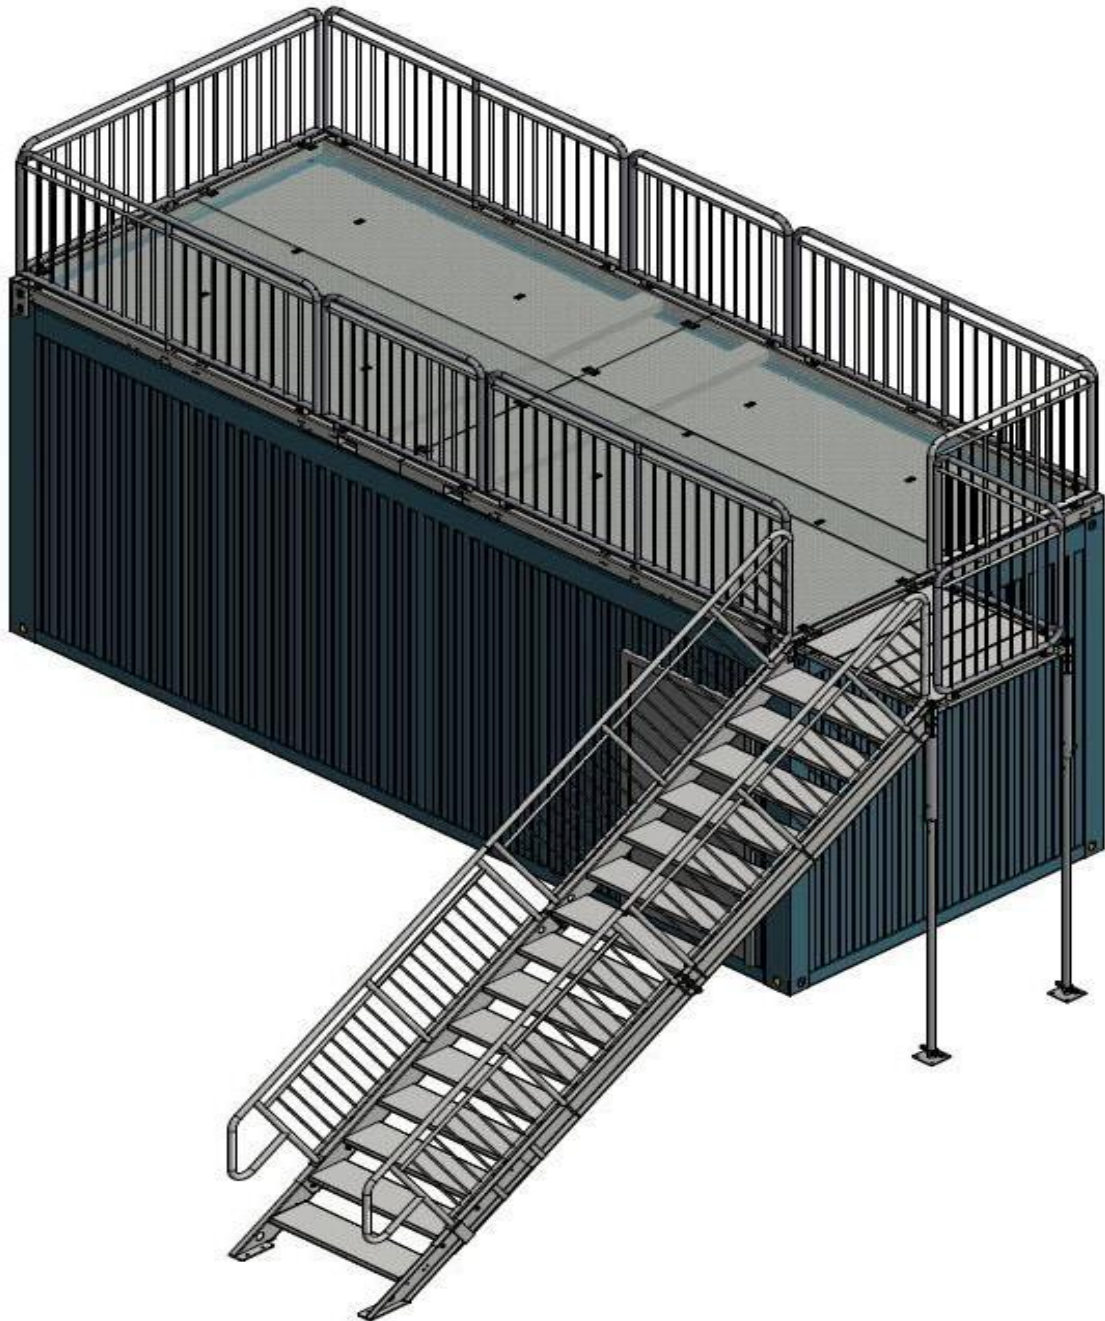


Variants


Variant 1

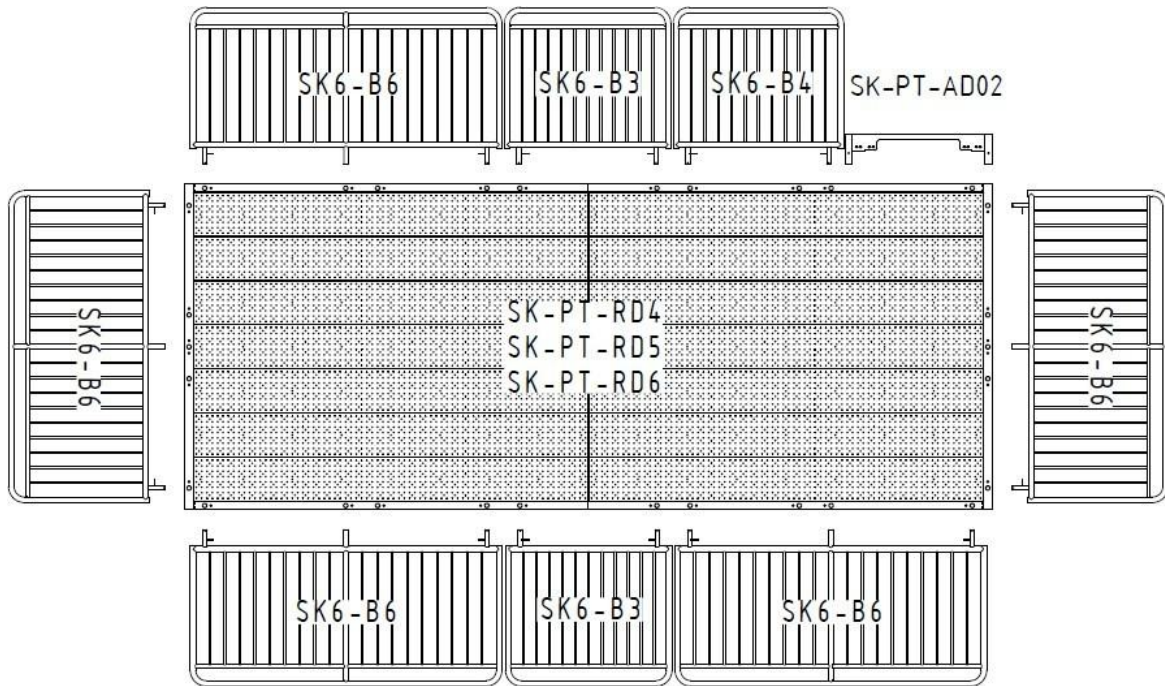


Variant 2

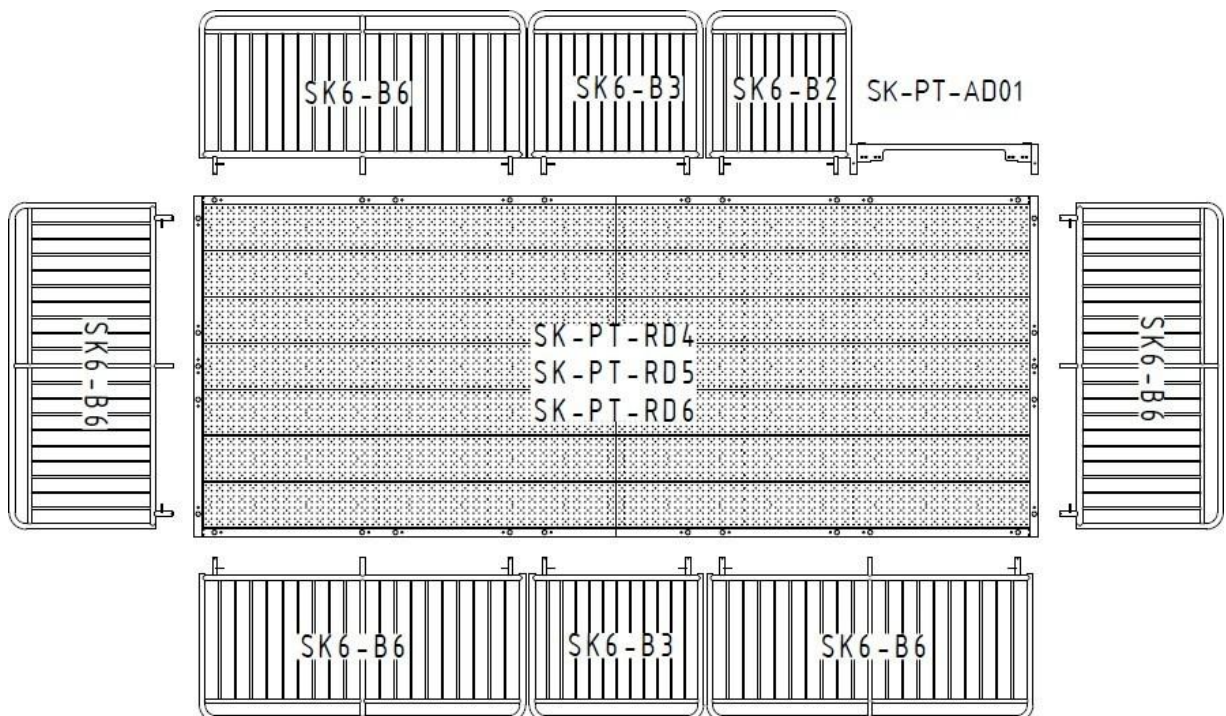


Variant 3

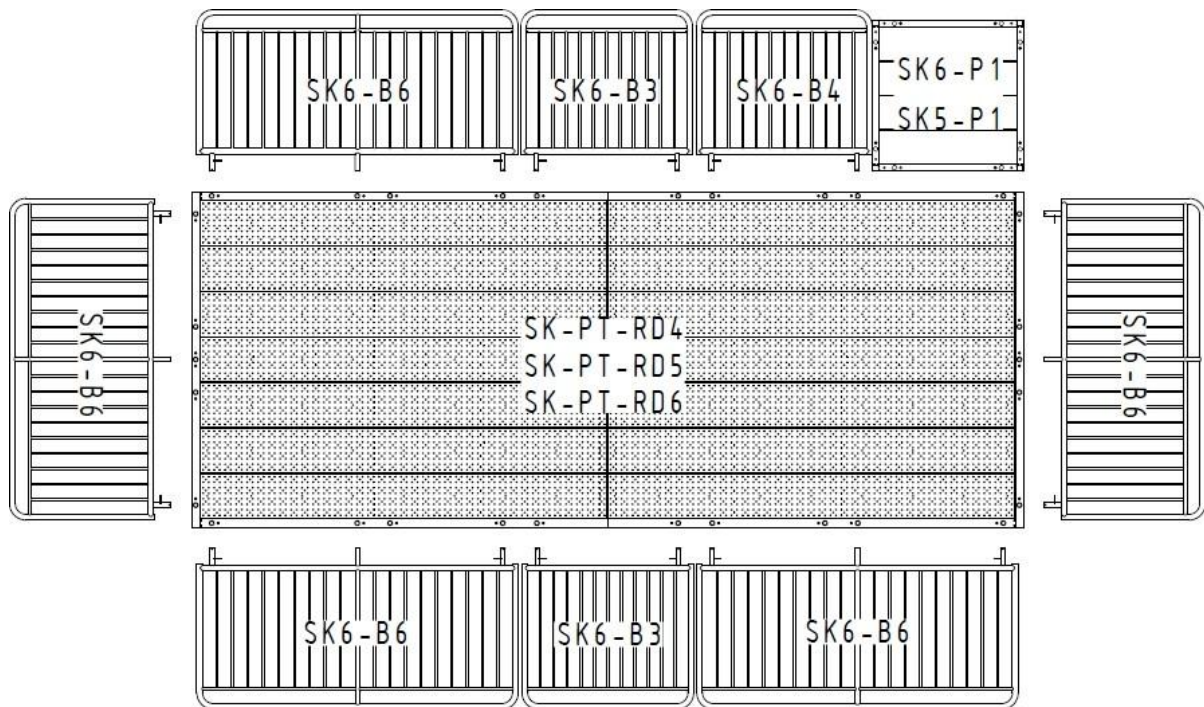


Variant 4

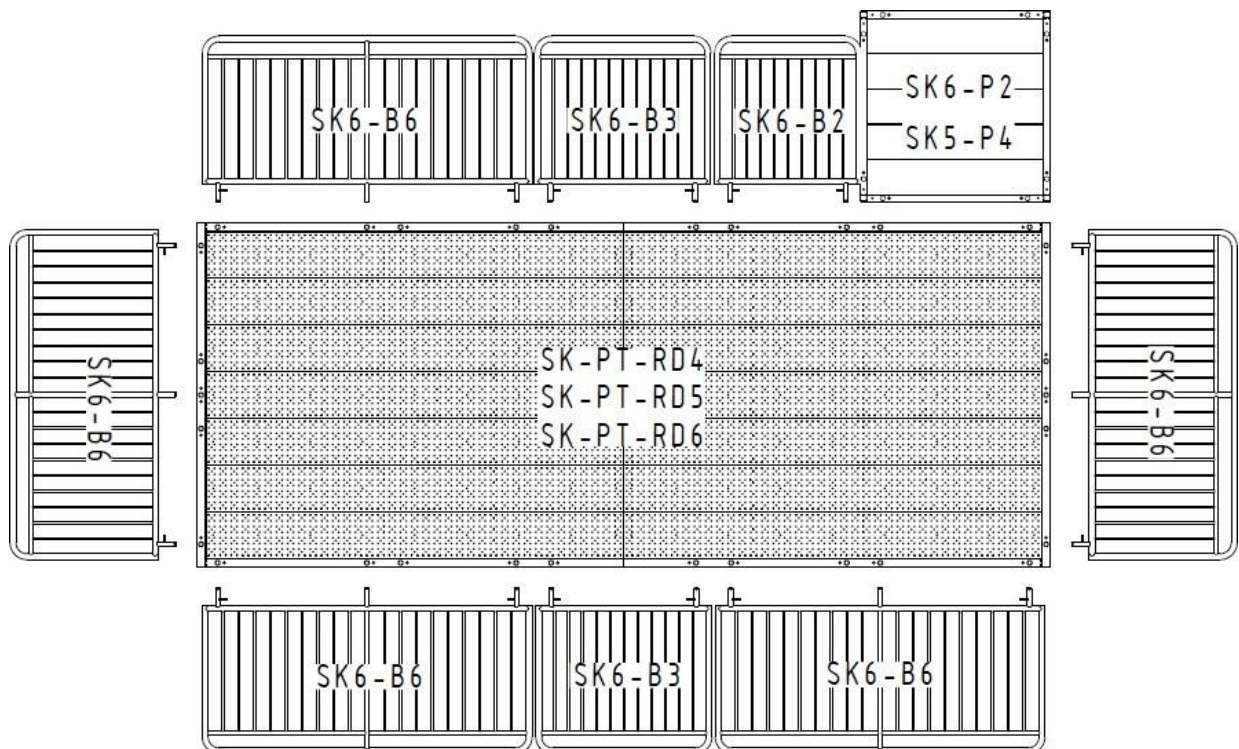


Variant 5

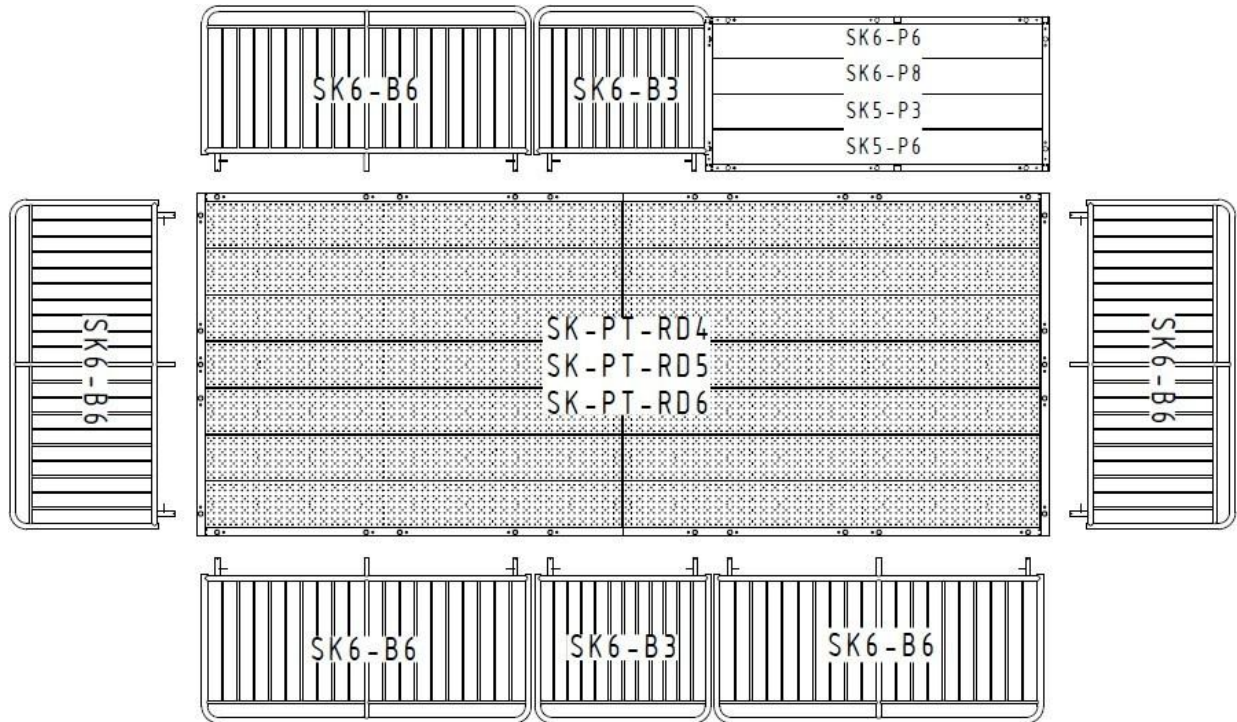


Variant 6

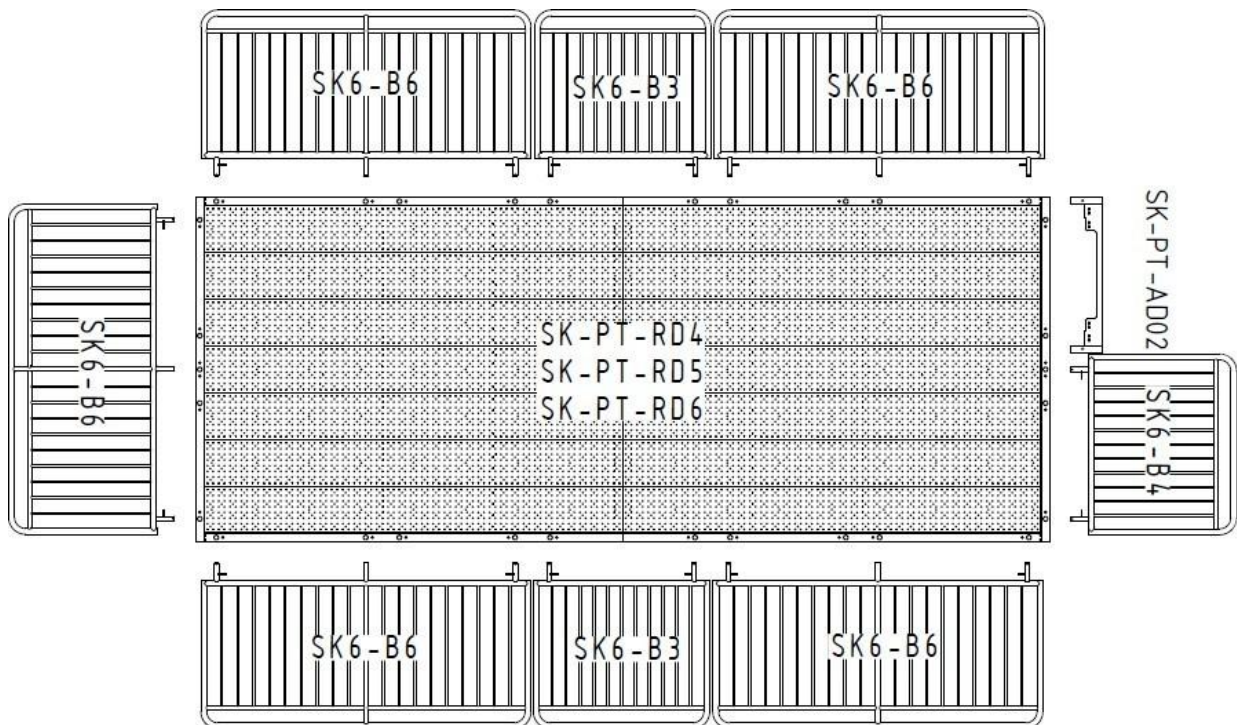


Variant 7

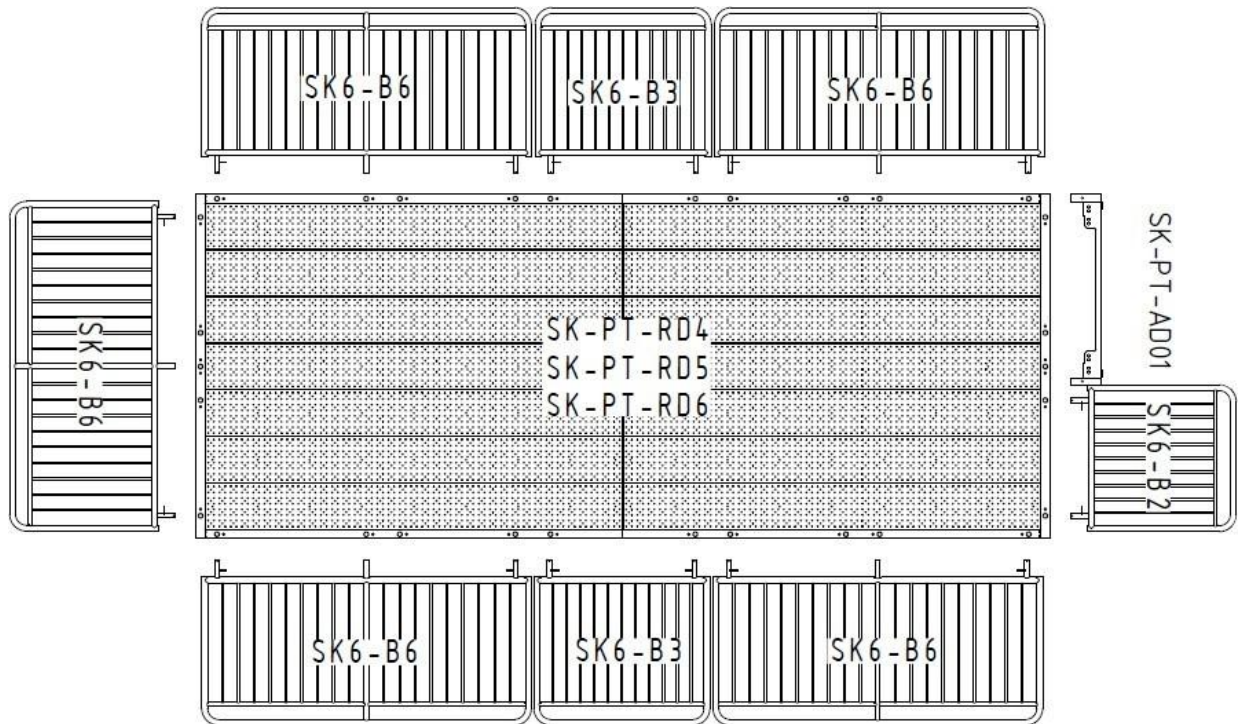


Variant 8

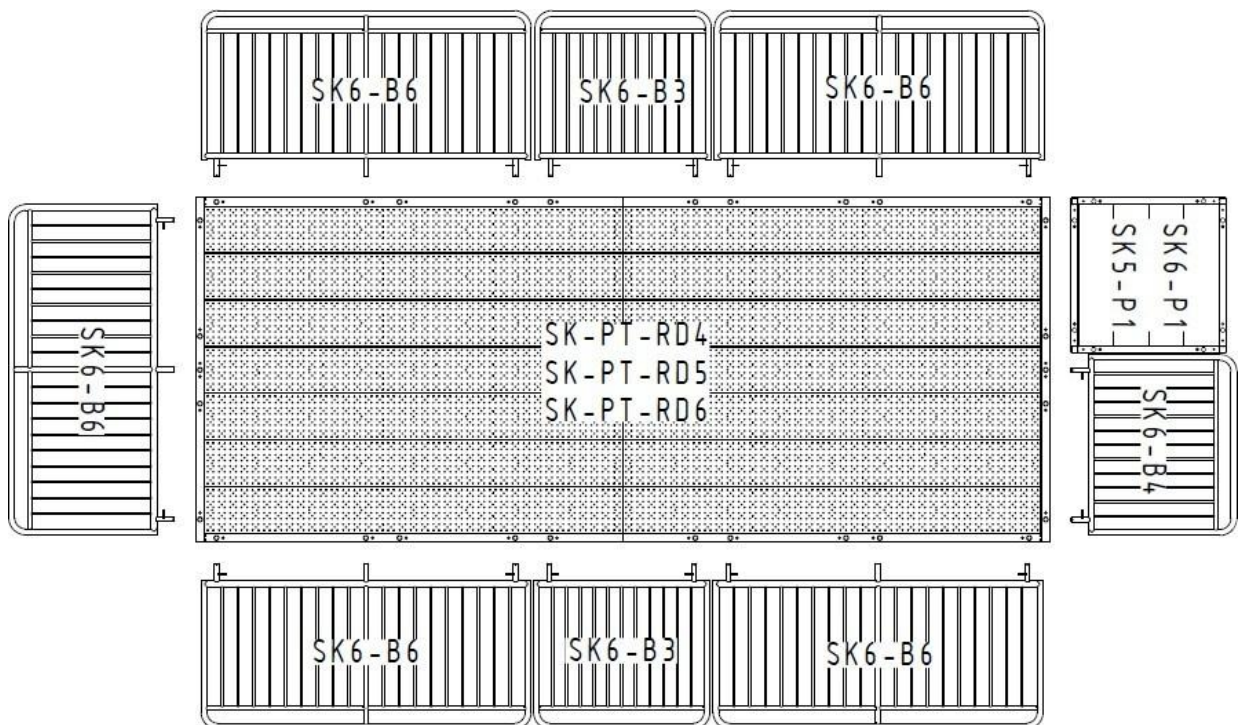





Variant 9

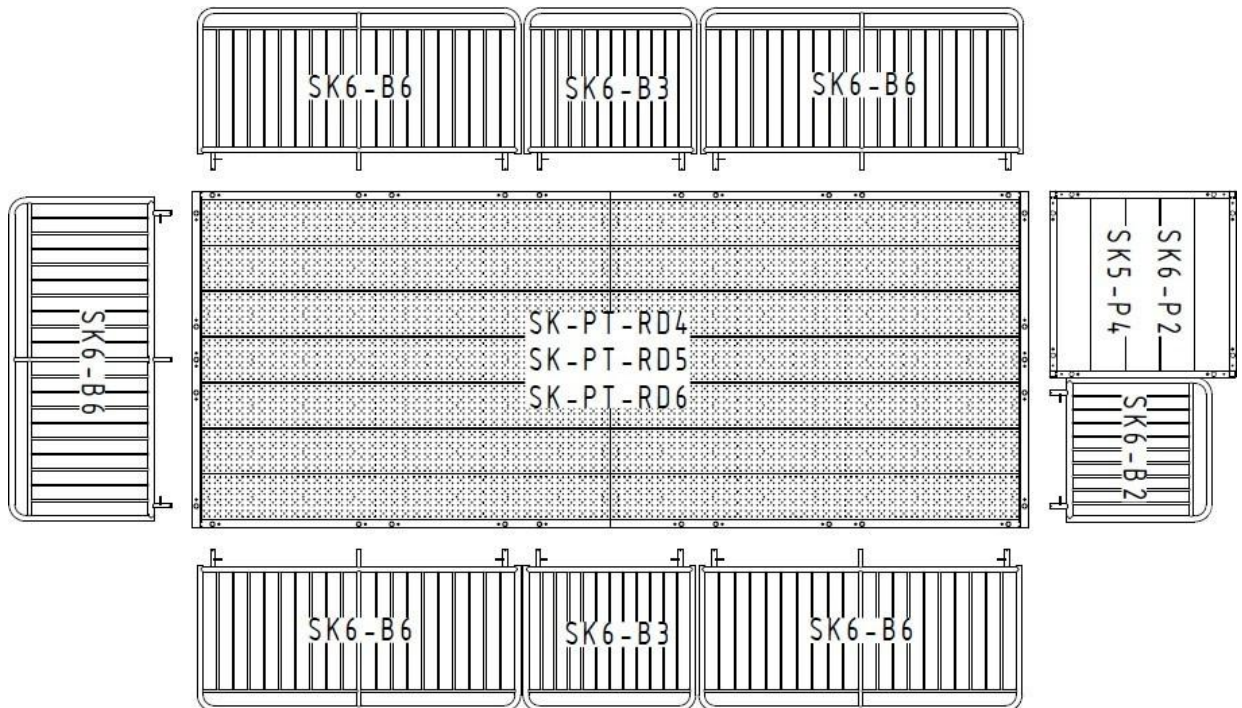


Variant 10

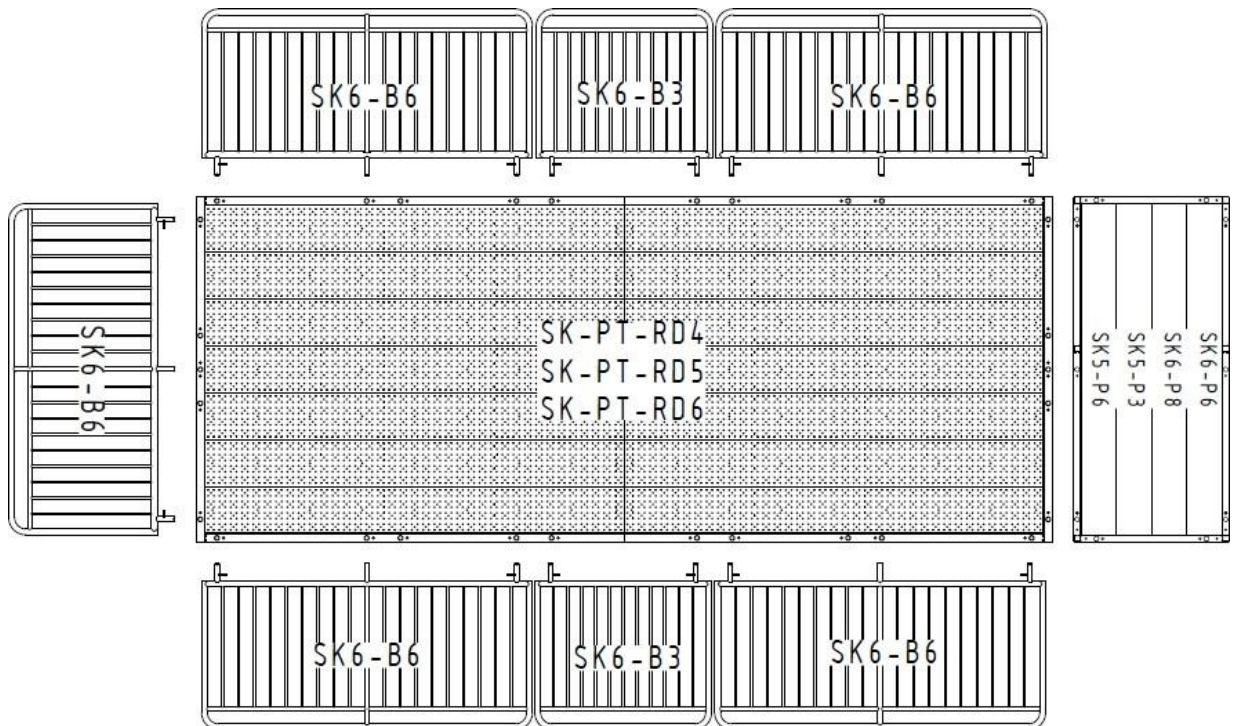

Parts

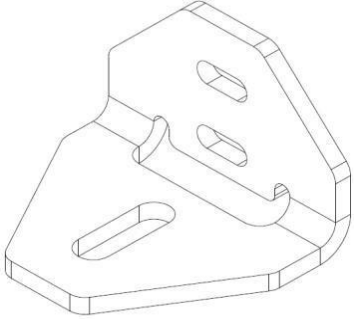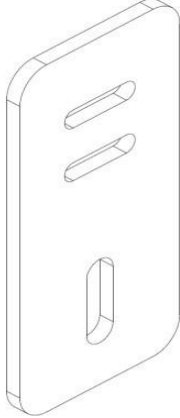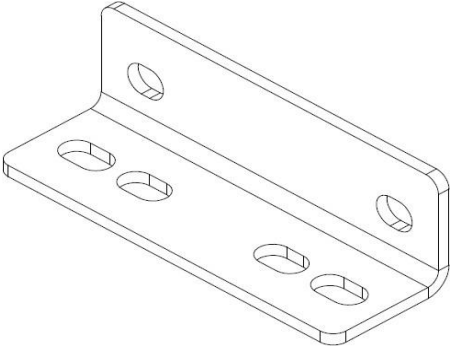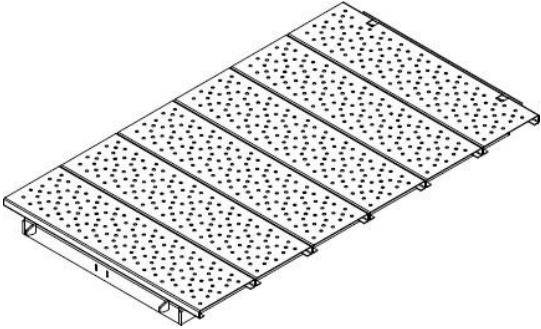
SKPT-L3  1,60 kg	SKPT-L1  2,14 kg
SKPT-L2  0,55 kg	SKPT-RD7c  55,38 kg

SKPT-RD7a

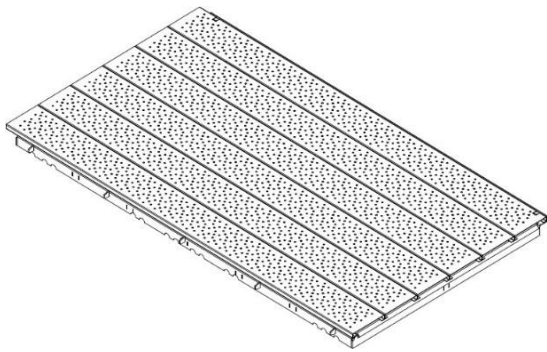


138,16 kg

SKPT-RD7b

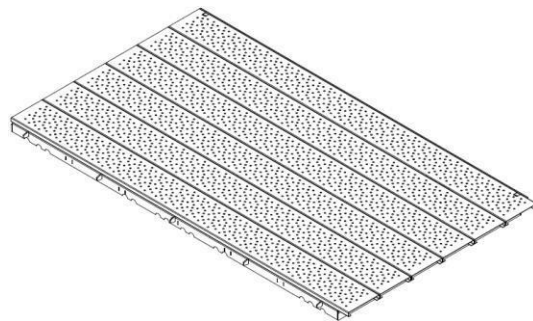


138,16 kg

SKPT-RA3

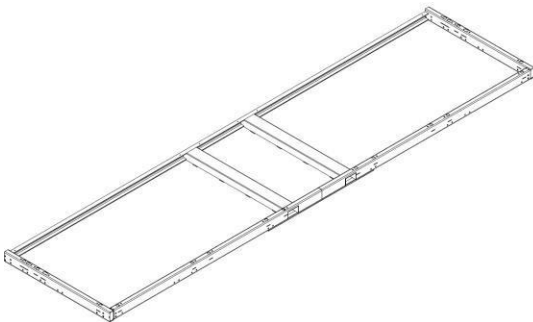


189,95 kg

SKPT-RD6

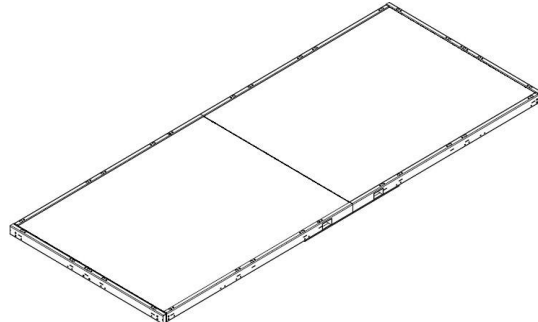


497,00 kg

SKPT-RD5

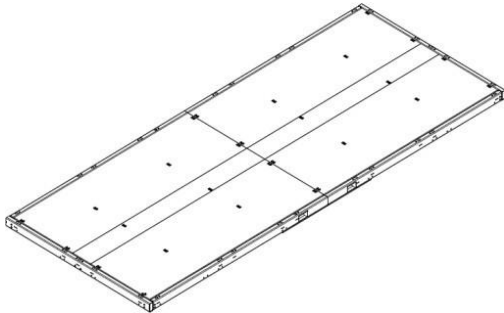





579,62 kg

SKPT-RD4

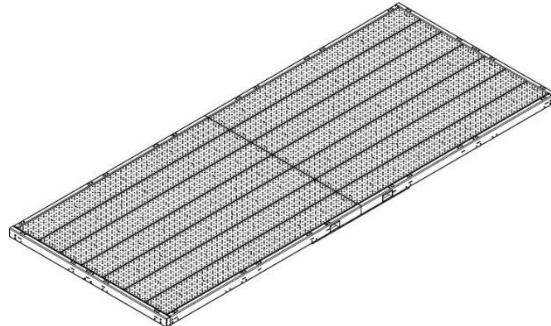


696,85 kg

Fasteners

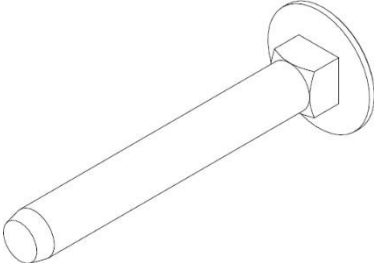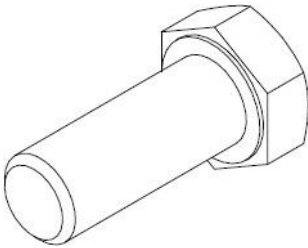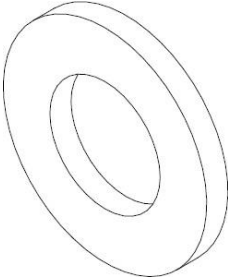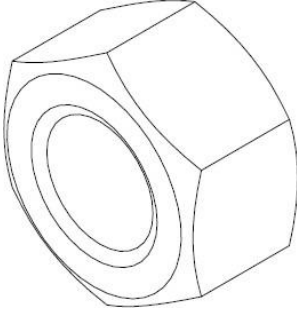 M12x90	 M12x30 M12x90 M10x30
 M12 M10	 M12

Tools

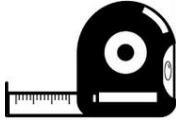	Wrenches: 17, 19, 22
	Level
	Measuring tape
	Lifting device with a lifting capacity of min. 1t


Parts list

Item number	Description	1	2	3	4	5	6	7	8	9	10
SKPT-RD4	Terrace floor	1	1	1	1	1	1	1	1	1	1
SKPT-L1	Terrace connection to container	4	4	4	4	4	4	4	4	4	4
SKPT-L3	Terrace connection to container	4	4	4	4	4	4	4	4	4	4
SKPT-L2	Platform connector for the terrace	0	0	2	2	2	0	0	2	2	2
SK6-B6	Railing 2.440 Safety	5	5	5	5	5	5	5	5	5	5
SK6-B3	Railing 1.250 Safety	2	2	2	2	2	2	2	2	2	2
SK6-B4	Railing 1.280 Safety	1	0	1	0	0	1	0	1	0	0
SKPT-AD02	Mounting adapter steps	1	0	0	0	0	1	0	0	0	0
SKPT-AD01	Mounting adapter steps	0	1	0	0	0	0	1	0	0	0
SK6-P1/SK5-P1	Platform 1.10	0	0	1	0	0	0	0	1	0	0
SK6-P2/SK5-P4	Platform 1.25	0	0	0	1	0	0	0	0	1	0
SK6-P6/SK5-P3	Platform 2.440	0	0	0	0	1	0	0	0	0	1
SK6-P8/SK5-P6	Platform 2.440 - 1.25	0	0	0	0	1	0	0	0	0	1
SK5-ZW	Bracket clamp	4	4	4	4	4	4	4	4	4	4
-	Hexagon head screw M12x30	9	9	9	9	9	9	11	9	11	10
-	Lock bolt M12x90	3	3	3	3	3	3	1	3	1	2


Item number	Description	1	2	3	4	5	6	7	8	9	10
-	Hexagon head screw M10x30	16	16	16	16	16	16	16	16	16	4
-	Hexagon head screw M12x90	0	0	4	4	4	0	0	4	4	4
-	Washer M12	12	12	20	20	20	12	12	20	20	20
-	Washer M10	16	16	16	16	14	16	16	16	16	14
-	Nut M12	0	0	4	4	4	4	0	0	4	4

Montage


Terrace short side: The fasteners are installed depending on the chosen configuration. Below are the spacings of the SKPT-L3 fasteners needed for installation. The fasteners must be installed prior to the installation of the decking on the container.

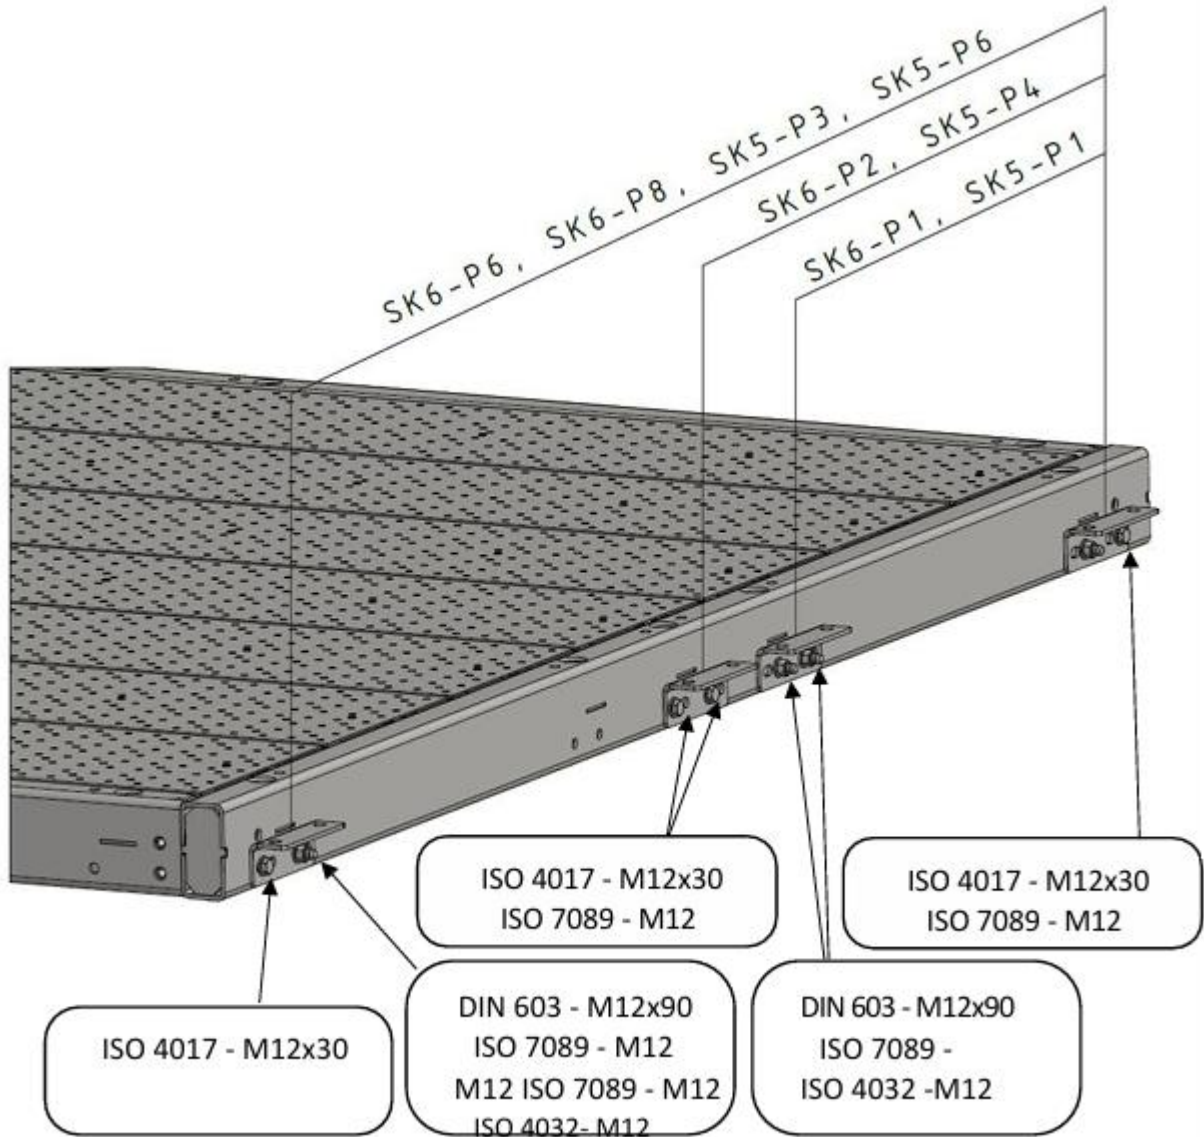


Terras long side:

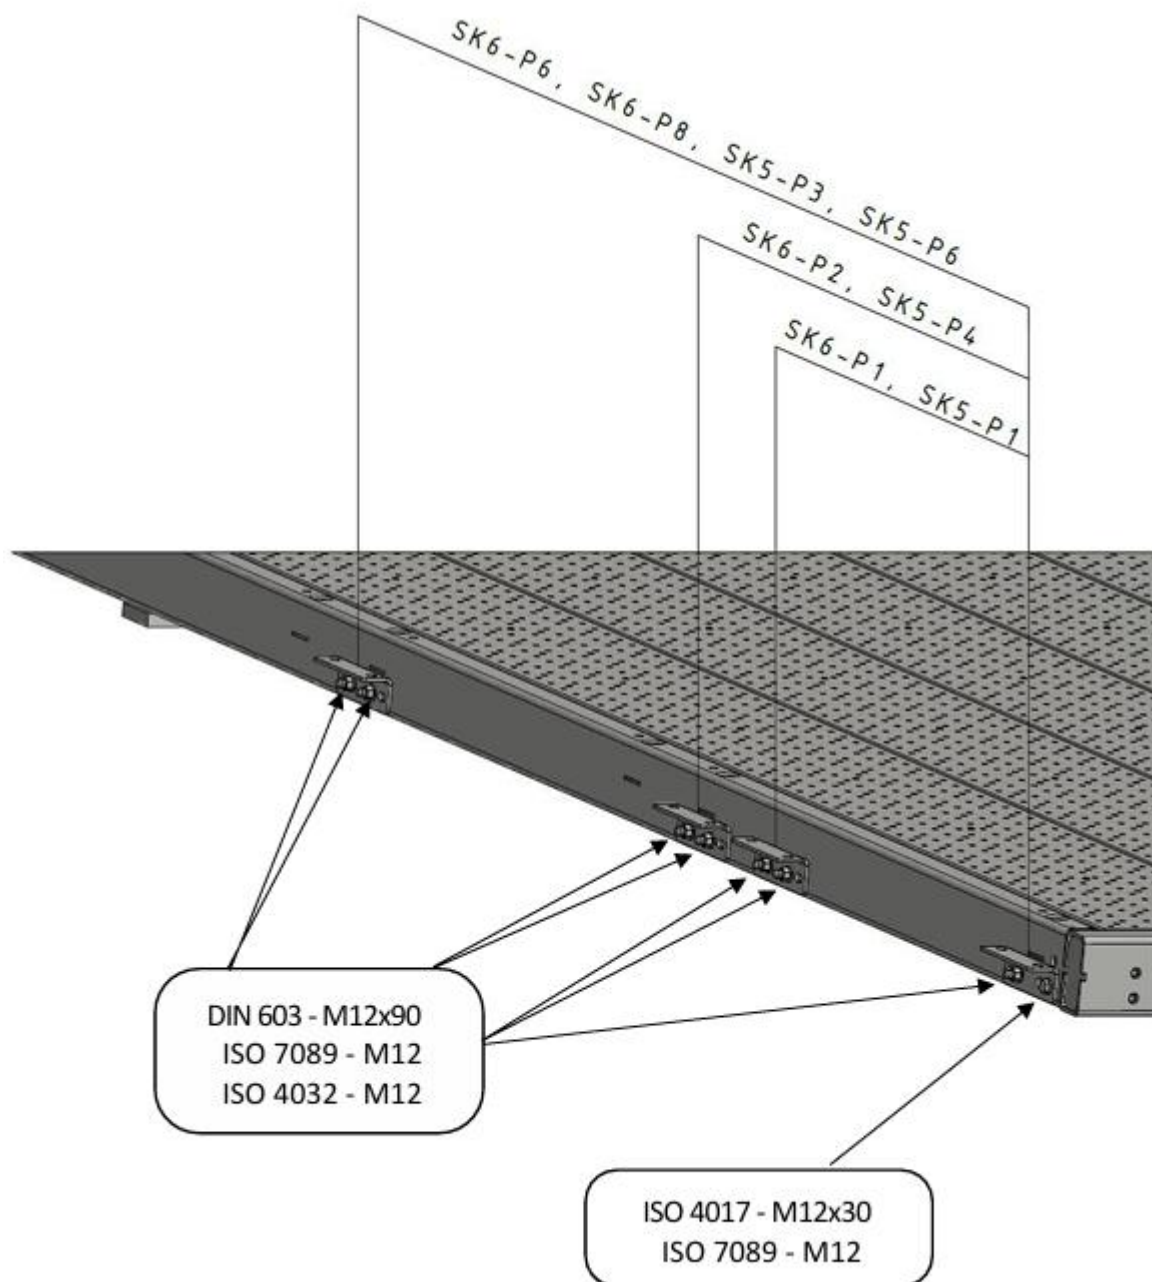


The adapters AD01 & AD02 & L3 connectors are mounted interchangeably with the platforms according to the user's preference. L3 Connectors are installed prior to installing the terrace on the container.

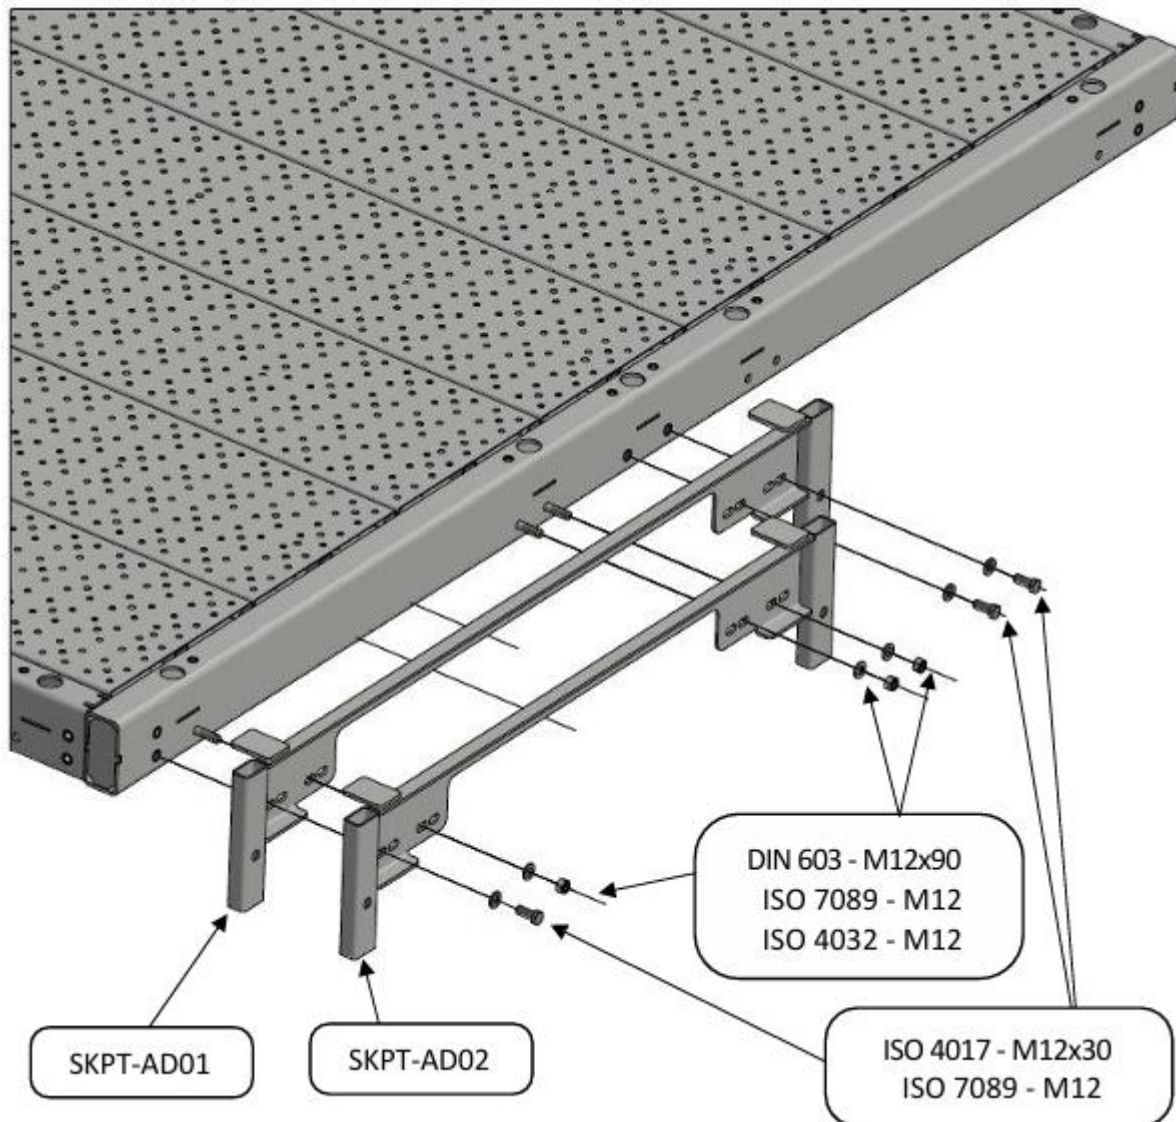


Installation of the terrace on the container. It is recommended that the terrace is installed using a lifting device equipped with a fork lifting capacity of more than 1 tonne. Mounting the terrace on the container using SKP-L1 connectors.

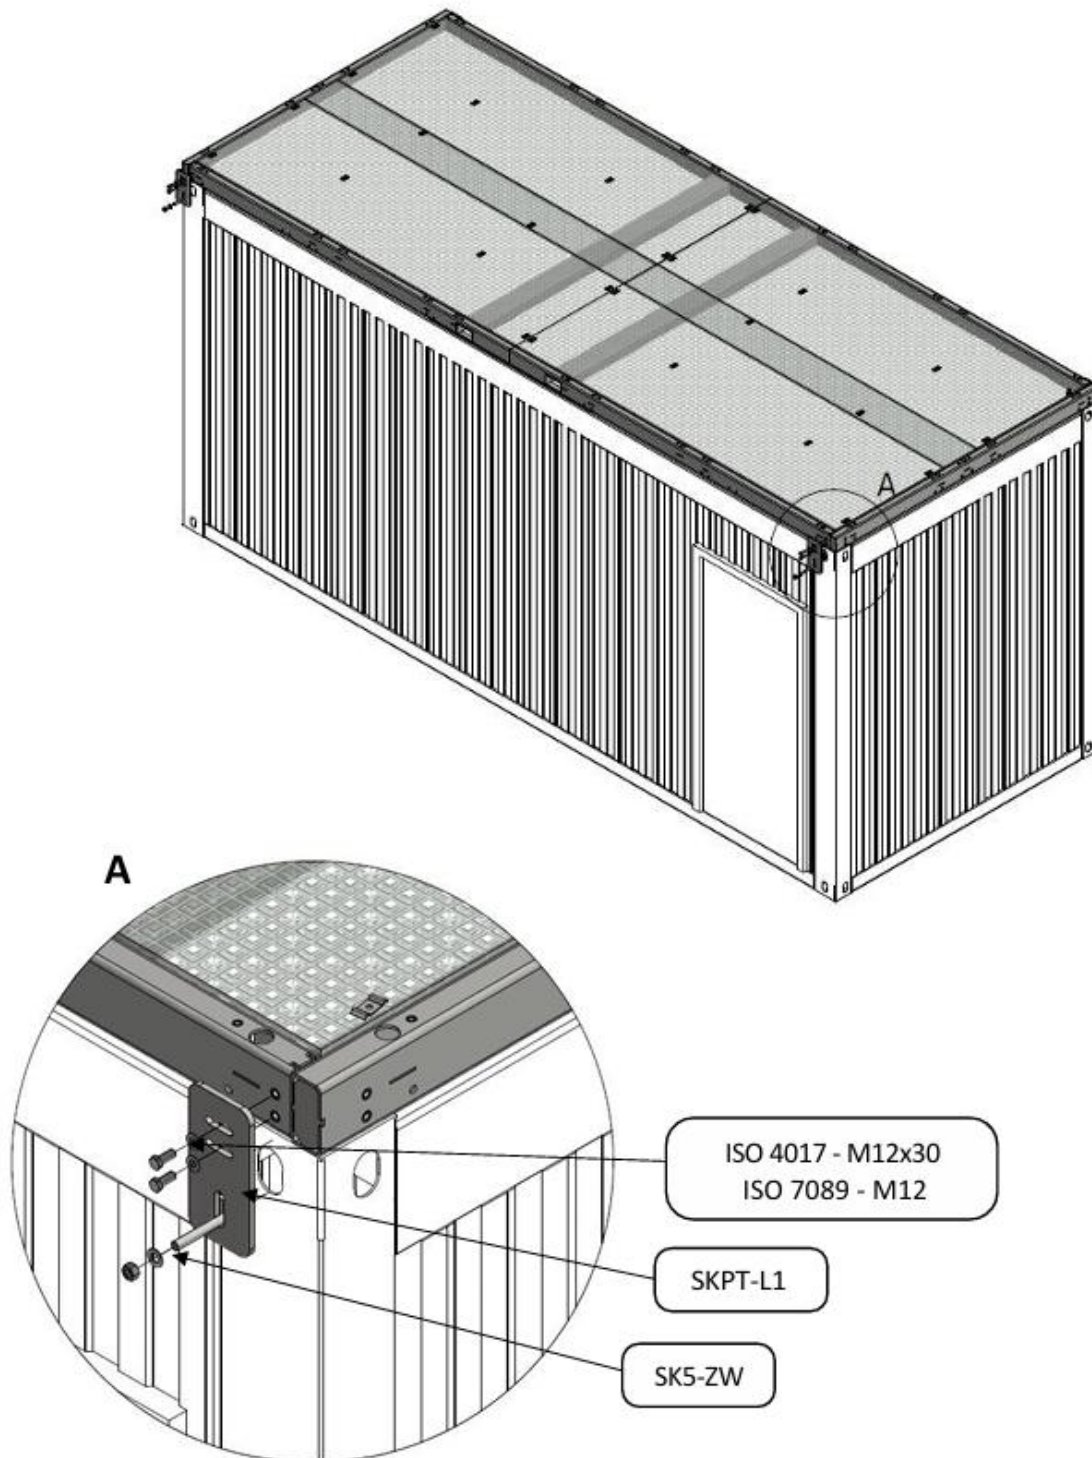


Mounting the terrace on the container using SKPT-L2 connectors.

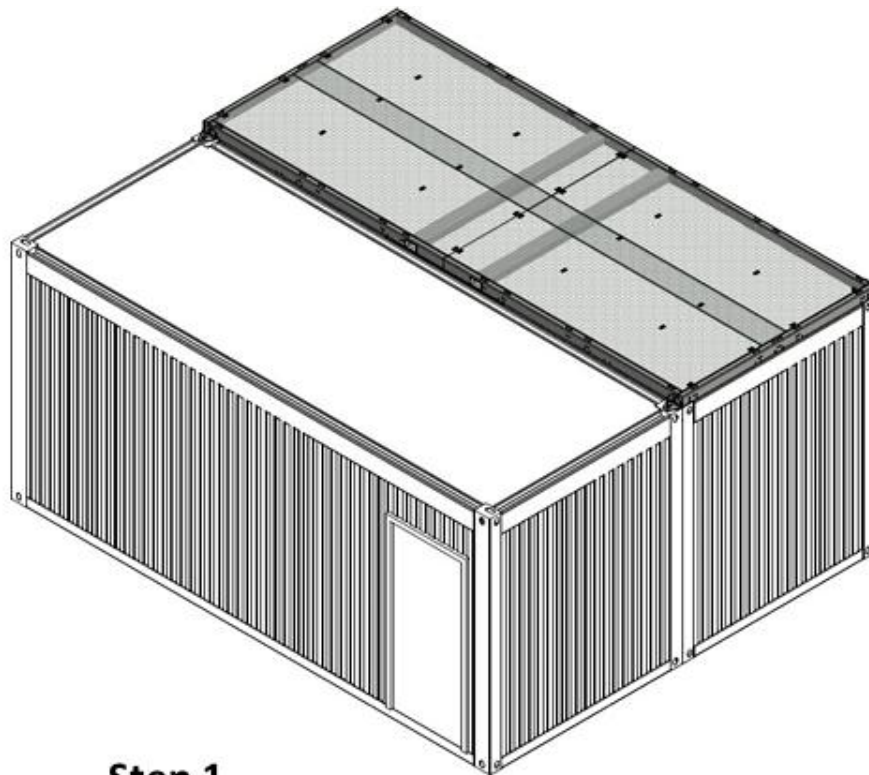


Step 1

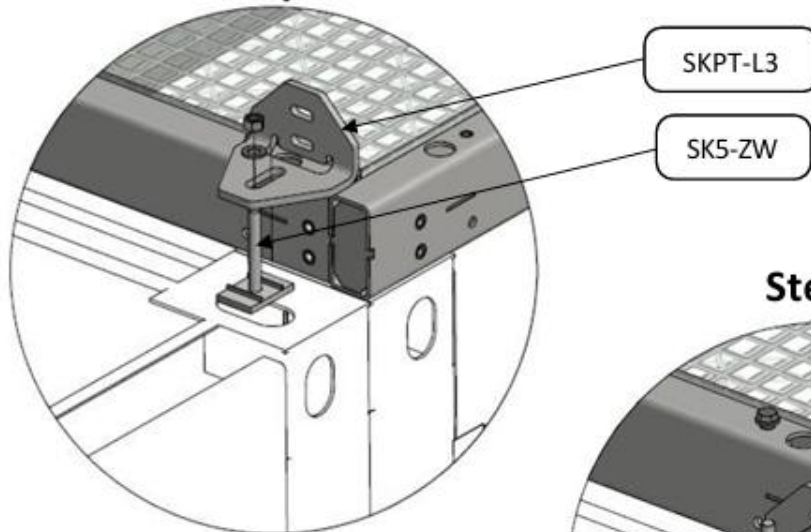

Step 2

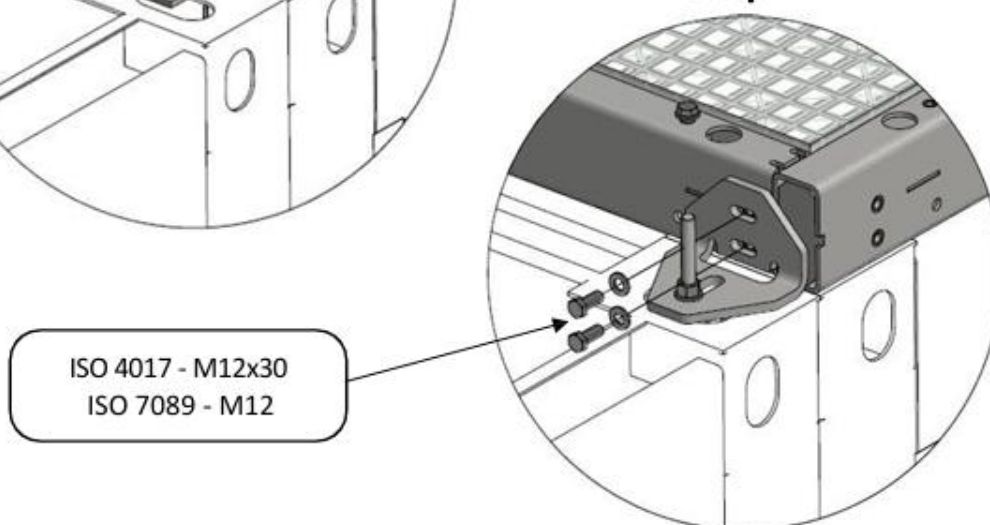

Installation of railings and platforms on the terrace.

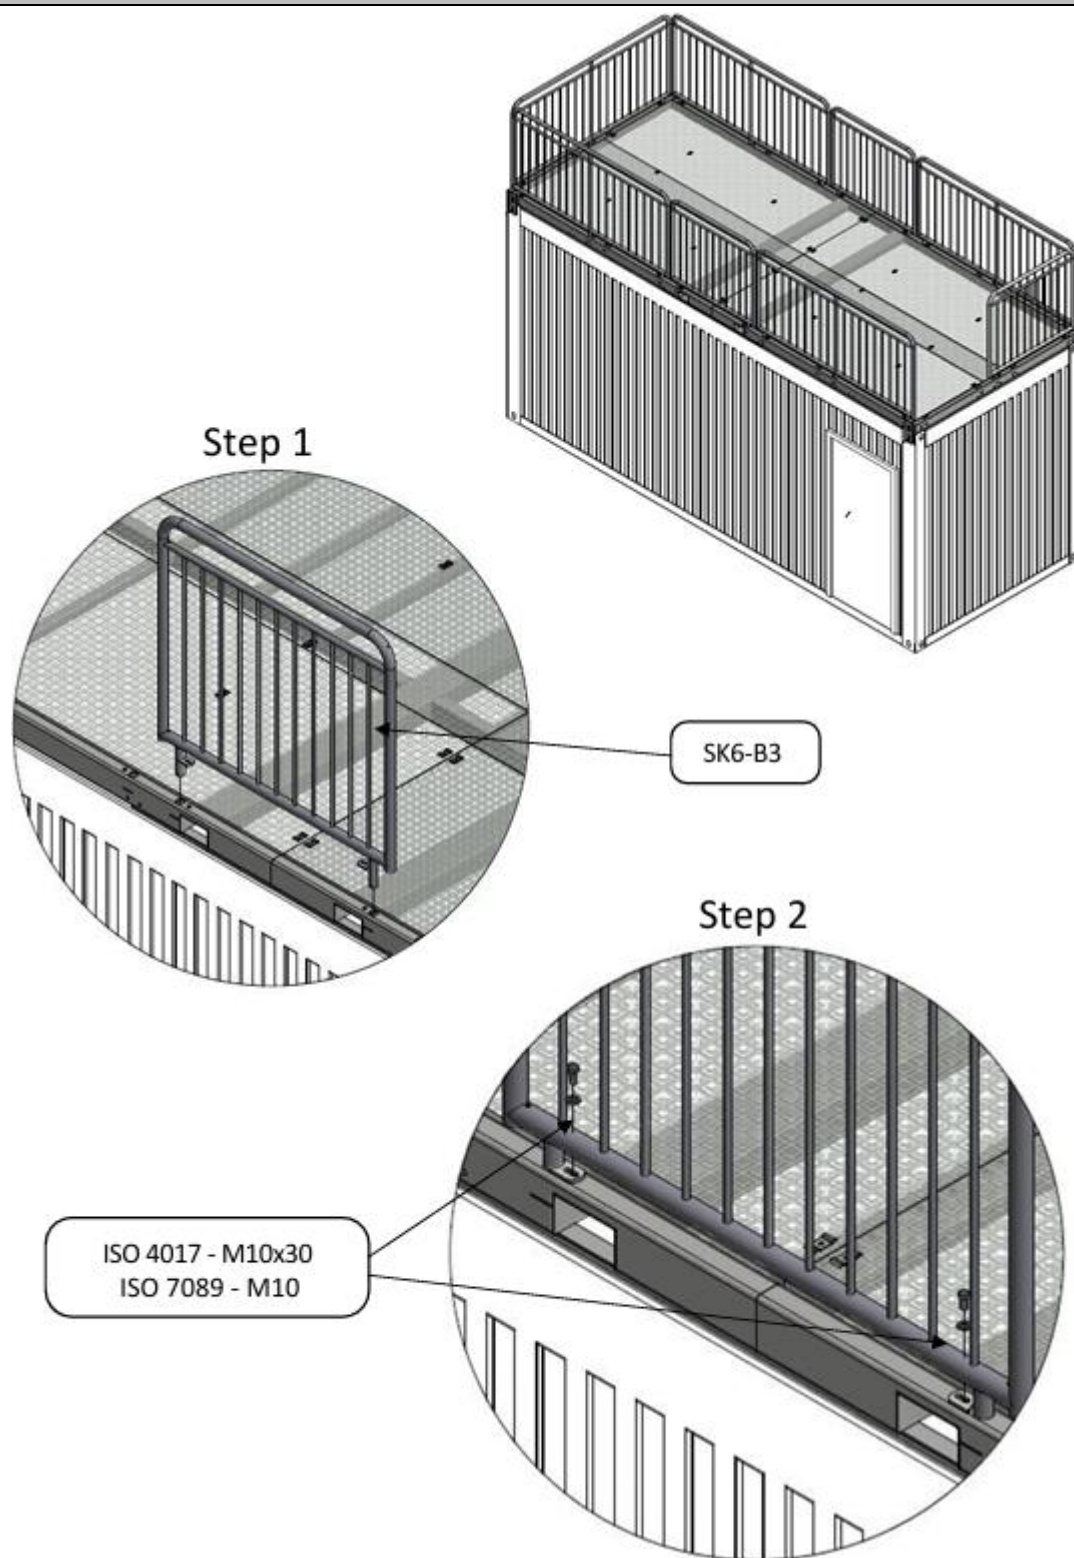

Assembly of the platform.

